

## Test Report

Number: HZ-23100177

Applicant: Monnalisa Spa  
Via M. Curie, 7/M  
52100 Arezzo (Italy)

Date: Oct. 16, 2023

Sample Description As Declared:  
One sample of 100% POLYESTER MESH in 0192.

Date Received : Oct. 09 2023  
Testing date : Oct. 09 2023~Oct. 13 2023  
Material Code : 3909  
Color Code : 0192  
Category : B



Approved By:  
Hangzhou Brachi Technological Services Co., Ltd



Lawrence Lang  
General Manager

Note: Results presented in this report are related only to the described sample and do not represent the complete lot.  
The samples are kept for 3 months.  
This test report has value only if the original copy and can not be partially reproduced without written approval of the laboratory.  
The above sample information is provided by customer, and the laboratory is not responsible for authenticity.  
The determination on conformance in this report is only based on the test results regardless of the uncertainty of the results.

### Italy Headquarters

BRACHI TESTING SERVICES srl  
Via Sabadell, 162/21 - 59100 Prato - Italy  
ph. +39.0574.591343 - fax +39.0574.593975  
www.brachi.it

### China Branch

HANGZHOU BRACHI TECHNOLOGICAL SERVICES Co., Ltd  
Room 1102, n.9 building, No.88 Jiangling Road  
Binjiang District, Hangzhou  
tel. +86.0571.82869868 - fax +86.0571.82869971

## Test Report

Number:HZ-23100177

### Conclusion:

	A
Fiber Composition	M
Formaldehyde Content	M
pH Value	M
Determination of Smell	M
Colour Fastness to Rubbing	M
Colour Fastness to Water	M
Colour Fastness to Perspiration	M
Colour Fastness to Light	#
Colour Fastness to Washing	#
AZO dyes	M

Note: M=Meet General's Requirement

#=No Specified Requirement

N/A= Not Applicable

F=Below General's Requirement

\*=No Submitted Information

N/L=Not List



### Italy Headquarters

BRACHI TESTING SERVICES srl  
Via Sabadell, 162/21 - 59100 Prato - Italy  
ph. +39.0574.591343 - fax +39.0574.593975  
www.brachi.it

### China Branch

HANGZHOU BRACHI TECHNOLOGICAL SERVICES Co., Ltd  
Room 1102, n.9 building, No.88 Jiangling Road  
Binjiang District, Hangzhou  
tel. +86.0571.82869868 - fax +86.0571.82869971

## Test Report

Number: HZ-23100177

### Test conducted (As Requested By The Applicant)

1. Fiber Composition(GB/T 29862-2013)(FZ/T 01057-2007)

A

Requirement

100.0%Polyester  
(Exclusive of decoration)

100%Polyester

2. Free and Hydrolyzed Formaldehyde (Water extraction method)(GB/T 2912.1-2009)

A  
ND

Requirement  
≤75mg/kg

Note: (1) ND = not detectable  
(2) Detection Limit =20 mg/kg

3. Determination of pH of the Aqueous Extract(GB/T 7573-2009)

A  
6.6

Requirement  
4.0-8.5

4. Determination of Smell(GB 18401-2010)

A  
No Abnormal Odor

Requirement  
No Abnormal  
Odor

5. Colour Fastness to Rubbing(GB/T 3920-2008)

Humidity: 65.1 %RH  
Temperature: 21.2 °C  
Friction head: 16mm  
Direction: Oblique

A  
4-5  
4-5

Requirement  
≥3  
≥2-3

Dry  
Wet  
Remark: This sample is in light color.

6. Colour Fastness to Water(37°C, 4h)(GB/T 5713-2013)

Colour Change 4-5  
Self Staining 4-5  
Colour Staining 4-5  
- Polyester 4-5  
- Cotton 4-5

Requirement  
≥3  
≥3  
≥3

### Italy Headquarters

BRACHI TESTING SERVICES srl  
Via Sabadell, 162/21 - 59100 Prato - Italy  
ph. +39.0574.591343 - fax +39.0574.593975  
www.brachi.it

### China Branch

HANGZHOU BRACHI TECHNOLOGICAL SERVICES Co., Ltd  
Room 1102, n.9 building, No.88 Jiangling Road  
Binjiang District, Hangzhou  
tel. +86.0571.82869868 - fax +86.0571.82869971

## Test Report

Number:HZ-23100177

### 7. Colour Fastness to Perspiration(37°C, 4h)(GB/T 3922-2013)

	A	Requirement
<b>Acid</b>		
Colour Change	4-5	≥3
Self Staining	4-5	≥3
Colour Staining		≥3
- Polyester	4-5	
- Cotton	4-5	
<b>Alkaline</b>		
Colour Change	4-5	≥3
Self Staining	4-5	≥3
Colour Staining		≥3
- Polyester	4-5	
- Cotton	4-5	

### 8. Colour Fastness to Light(GB/T 8427-2019)

Exposure cycle A1

	A	Requirement
First stage		
Grade	4	-
Remark: Method 3, BWR 4		

### 9. Colour Fastness to Washing(GB/T 3921-2008, Method A(1))

	A	Requirement
Colour Change	4-5	-
Self staining	4-5	-
Colour Staining		-
- Polyester	4-5	
- Cotton	4-5	

#### Italy Headquarters

BRACHI TESTING SERVICES srl  
Via Sabadell, 162/21 - 59100 Prato - Italy  
ph. +39.0574.591343 - fax +39.0574.593975  
www.brachi.it

#### China Branch

HANGZHOU BRACHI TECHNOLOGICAL SERVICES Co., Ltd  
Room 1102, n.9 building, No.88 Jiangling Road  
Binjiang District, Hangzhou  
tel. +86.0571.82869868 - fax +86.0571.82869971

## Test Report

Number:HZ-23100177

### 10. AZO dyes(GB/T 17592-2011(Annex B))

Detected By Gas Chromatographic-Mass Spectrometric(GC-MS).

No.	Forbidden Amines Substances	CAS-No.	Result
			A
1.	4-aminodiphenyl/xenylamine/ Biphenyl-4-ylamine	92-67-1	ND
2.	Benzidine	92-87-5	ND
3.	4-chlor-o-toluidine	95-69-2	ND
4.	2-naphthylamine	91-59-8	ND
5.	o-aminoazotoluene/4-o-tolylazo-o-toluidine/ 4-amino-2',3-dimethylazobenzene	97-56-3	ND
6.	2-amino-4-nitrotoluol/5-nitro-o-toluidine	99-55-8	ND
7.	p-chloranilin/4-chloroaniline	106-47-8	ND
8.	2,4-diaminoanisol/ 4-methoxy-m-phenylenediamine	615-05-4	ND
9.	4,4'-diaminodiphenylmethane/ 4,4'-methylenedianiline	101-77-9	ND
10.	3,3'-dichlorobenzidine/ 3,3' dichlorobiphenyl-4,4'-ylenediamine	91-94-1	ND
11.	3,3'-dimethoxybenzidine/o-dianisidine	119-90-4	ND
12.	3,3'-dimethylbenzidine/4,4'-bi-o-Toluidine	119-93-7	ND
13.	3,3'-dimethyl-4,4'-diaminodipenylmethane/ 4,4'-methylenedi-o-toluidine	838-88-0	ND
14.	p-cresidin/6-methoxy-m-toluidine	120-71-8	ND
15.	4,4'-methylen-bis-(2-chloro-aniline)/ 2,2'-dichloro-4,4'methylene-dianiline	101-14-4	ND
16.	4,4'-oxydianiline	101-80-4	ND
17.	4,4'-thiodianiline	139-65-1	ND
18.	o-toluidine/2-aminotoluene	95-53-4	ND
19.	2,4-toluylendiamine/ 4-methyl-m-phenylenediamine	95-80-7	ND
20.	2,4,5-trimethylaniline	137-17-7	ND
21.	o-anisidine/ 2-methoxyaniline	90-04-0	ND
22.	4-aminoazobenzene	60-09-3	ND
23.	2,4-Xylidine	95-68-1	ND
24.	2,6-Xylidine	87-62-7	ND
<b>Overall Rating</b>			<b>PASS</b>

Note: ND = Not Detectable  
Detection Limit = 5 mg/kg

Client's Requirement: No relevant amine exceeding 20 mg/kg (MAX.)

### Italy Headquarters

BRACHI TESTING SERVICES srl  
Via Sabadell, 162/21 - 59100 Prato - Italy  
ph. +39.0574.591343 - fax +39.0574.593975  
www.brachi.it

### China Branch

HANGZHOU BRACHI TECHNOLOGICAL SERVICES Co., Ltd  
Room 1102, n.9 building, No.88 Jiangling Road  
Binjiang District, Hangzhou  
tel. +86.0571.82869868 - fax +86.0571.82869971



BRACHI  
TESTING  
SERVICES




中国认可  
国际互认  
检测  
TESTING  
CNAS L5463



## Test Report

Number:HZ-23100177

Sample Picture:

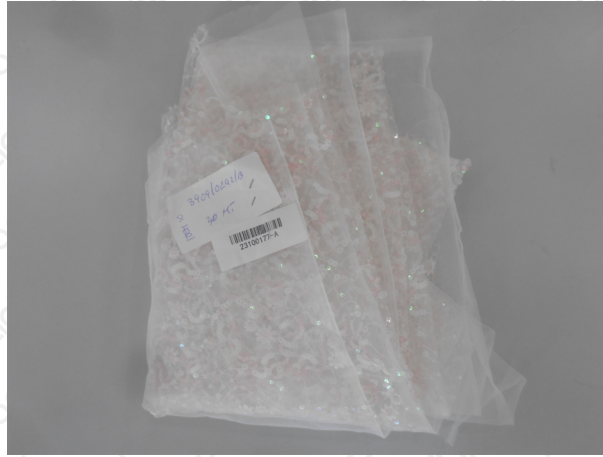

A

\*\*\*End of the Report\*\*\*



### Italy Headquarters

BRACHI TESTING SERVICES srl  
Via Sabadell, 162/21 - 59100 Prato - Italy  
ph. +39.0574.591343 - fax +39.0574.593975  
www.brachi.it

### China Branch

HANGZHOU BRACHI TECHNOLOGICAL SERVICES Co., Ltd  
Room 1102, n.9 building, No.88 Jiangling Road  
Binjiang District, Hangzhou  
tel. +86.0571.82869868 - fax +86.0571.82869971